

3 Phase 5000 S Specification Sheet



For any queries contact WMF sales department
Tel: 01895 816100 or Email: sales@wmf.uk.com

Coffee Machine Requirements

3P+E+N 415v 16amp IP44 Socket



* We recommend that an isolator switch is also fitted with the socket

Milk Cooler / Cup & Cool Requirements

3 Pin 13 amp Socket



WMF 5000 S Dimensions

Width: 325 mm

Height: 706 mm

Depth: 590 mm

10.5L Centre Cooler Dimensions

Width: 261 mm

Height: 530.5 mm

Depth: 469 mm



Water Supply Feed

Water supply to be approximately 2.5bar
flow pressure at 8 litres per minute.

Pipe to be terminated with a Male 3/4" Stop
Tap for the WMF filter to be connected by
the WMF Technician.



WMF Water Filter


Height = 530mm

Diameter = Ø 145mm



Waste Water Drainage

Funnel or approx 70mm
drainwaste with trap.

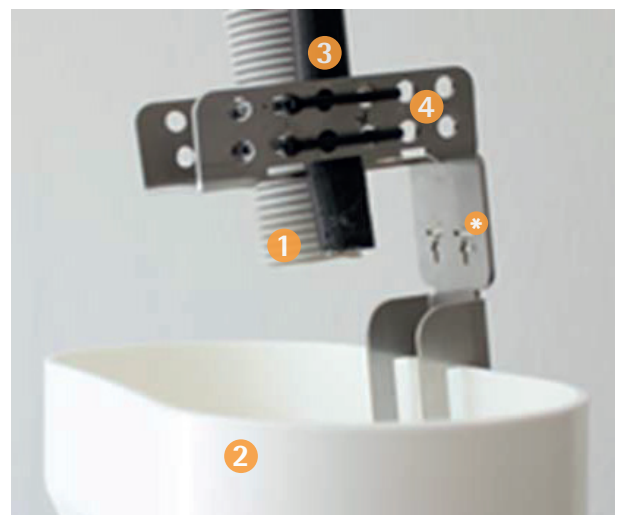

- 1 General waste pipe from the machine going into a drain stand pipe.
 - 2 Funnel drain or an approx. 70mm diameter drain waste with trap.
 - 3 Separate milk waste pipe from machine.
 - 4 Metal bracket to hold in position with an air gap from the end of the pipes and the drainage entrance.
- * Note: Indication of where the pipes end to enable the air gap.

NB. ALL SERVICES ARE TO BE WITHIN 1 METRE OF THE MACHINE.